

# INLAND TRUCK PARTS & SERVICE

An Employees Owned Company

115 NORTH 16TH STREET  
PO BOX 1917  
Billings, MT 59103  
1-800-332-7077

Invoice

1987 KW W900

DATE	INVOICE NO.
11-26-13	1-87820
CUSTOMER P.O. NO.	CUSTOMER NO.
EVERETT	100333

REFERENCE	SHIP VIA	SHIP DATE	TERMS	SLSM	COPIES	BY	PAGE
1-14265		11-26-13	NET 10TH	RWB		Y	1


**SOLD TO:** EVERETT GABLE  
2530 GOODMAN LN  
BILLINGS, MT 59101  
1-406-656-1570

Shipped To: EVERETT GABLE  
2530 GOODMAN LN  
BILLINGS, MT 59101  
1-406-656-1570

ITEM NO.	QUANTITY			PROG. LINE	PART NUMBER	DESCRIPTION	LIST PRICE	UNIT PRICE	EXTENSION
	ORDERED	SHIP	B/O						
1					Make/Year/Model: 1987 KENWORTH W900				
2					Unit Serial # : 5348996				
3					*****				
4					< *** Repair Order# 1-64881 *** >				
5					CONDITION	REPLACE INJECTOR 4			
6					CORRECTION	REPLACED NUMBER FOUR INJECTOR AND CHECKED VALVE SETTINGS O			
7						4,5,6. REPLACED FUEL FILTER. ENGINE STILL HAD MISS-REMOVED			
8						HEAD AND FOUND #4 PISTON HIT THE VALVE. REBUILT ENGINE AND			
9						REPLACED THE REST OF THE INJECTORS. HEAD, TURBO, ROD AND			
10						MAIN BEARINGS, R&I FRONT GEAR COVER AND PLATE REPLACE			
11						GASKETS FOR OIL LEAKS.			
12						REPLACE FRONT CRANK SEAL.			
13						REPLACED UPPER AND LOWER RADIATOR HOSES.			
14						WORK LISTED BELOW AND PARTS FOR THE WORK WAS NOT INCLUDED			
15						IN ESTIMENT.			
16						REMOVED RADIATOR AND HAD IT GONE THOUGH BY MT RAD 40X			
17						PLUGGED.			
18						REPLACED FRONT MOTOR MOUNTS.			
19						REPLACE POWER STEERING PUMP, FILTER AND HOSES.			
20						REPLACE HUMP HOSES AND CLAMPS.			
21						ADJUSTED CLUTCH TO SPECS AND GREASED THROUGH-BEARING.			
22	6	6	0	329	PART	CAT PARTS		109.60	657.60
23						-- OR3421 NOZZLE			
24	2	2	0	329	1H-1023	O-RING/3406-GRF	1.71	1.40	2.80
25	1	1	0	329	OR-3674	3406B LOADED HEAD	5,017.48	2,343.75	2,343.75
26	1	1	0	329	10R-0482	PUMP GP WATER	989.49	500.50	500.50
27	12	12	0	329	305-6843	SPRING	17.24	10.08	120.96
28	1	1	0	329	290-2060	GSKT KIT	861.87	505.69	505.69
29	2	2	0	329	4N-1151	OIL PAN GASKET	42.59	24.20	48.40
30	6	6	0	329	PART	CAT PARTS		607.26	3,643.56
31						-- 20R1115			
32	1	1	0	329	5P-8068	O-RING	25.47	16.17	16.17
33	1	1	0	329	5P-5846	SEAL O-RING	27.20	17.22	17.22
34	6	6	0	329	PART	CAT PARTS		42.46	254.76

RECEIVED BY \_\_\_\_\_

SEE WARRANTIES  
ON REVERSE SIDE

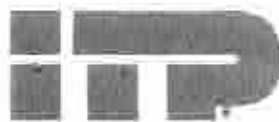

# INLAND TRUCK PARTS & SERVICE

An Employee Owned Company

115 NORTH 16TH STREET  
PO BOX 1917  
Billings, MT 59103  
1-800-332-7077

Invoice

DATE	INVOICE NO.
11-25-13	1-87820
CUSTOMER P.O. NO.	CUSTOMER NO.
EVERETT	100333

REFERENCE	SHIP VIA	SHIP DATE	TERMS	BSM	CODES	END	PAGE
1-14265		11-25-13	NET 10TH	RWB		Y	2

**SOLD TO:** EVERETT GABLE  
2530 GOODMAN LN  
BILLINGS, MT 59101  
1-406-656-1570

Shipped To: EVERETT GABLE  
2530 GOODMAN LN  
BILLINGS, MT 59101  
1-406-656-1570

ITEM NO.	QUANTITY			ENCL. LINE	PART NUMBER	DESCRIPTION	LIST PRICE	UNIT PRICE	EXTENSION
	ORDERED	SHIP	E/O						
35					-- 4W5702 BEARING				
36	7	7	0	329	PART	CAT PARTS		69.68	487.76
37					-- 4W5698 BEARING				
38	2	2	0	329	253-1752	THRUST PLATE	80.68	46.91	93.82
39	1	1	0	329	2341874	FT STRUCT KIT	527.34	316.74	316.74
40	1	1	0	329	35-9643	T-STAT SEAL	27.13	16.32	16.32
41	1	1	0	329	247-7133	REGULATOR	101.70	59.82	59.82
42	4	4	0	329	2N-2765	TURBO MOUNTING BOLT	11.58	6.94	27.76
43	16	16	0	329	2N-2766	LOCK NUT	10.43	6.25	100.00
44	1	1	0	329	6L-8562	STUD	18.92	11.06	11.06
45	11	11	0	329	45-6137	BOLT	21.36	12.49	137.39
46	1	1	0	329	0R5728	TURBO	3,746.17	1,799.51	1,799.51
47	2	2	0	415	TR22570	TRUCK BELT	53.42	31.02	62.04
48	2	2	0	760	PA1637-FN	AIR FILTER	111.44	44.83	89.66
49	2	2	0	415	9625	XL - V-BELT	45.89	26.64	53.28
50	1	1	0	329	1317123	BUSHING	84.72	50.90	50.90
51	1	1	0	329	PART	CAT PARTS		64.45	64.45
52					-- 8N8258 BUSHING				
53	2	2	0	196	PL1013	Motor Mount	40.62	40.62	81.24
54	2	2	0	263	PART	MISC. PART		36.62	73.24
55					-- K350-613 PLATE				
56	1	1	0	263	PART	MISC. PART		441.32	441.32
57					-- 14-19127-000 PUMP				
58	4	4	0	455	HE8699	CAC HOSE	96.86	55.73	222.92
59	8	8	0	455	CM4844	CAC HOSE CLAMP	26.89	12.18	97.44
60	1	1	0	415	G60606-0808	1/2" CLOSE NIPPLE	5.68	3.60	3.60
61	1	1	0	415	G60614-0806	1/2" TO 3/8" BUSHING	3.96	2.44	2.44
62	4	4	0	415	28409	3/8" SAFETY STRIPE	1.93	1.31	5.24
63	1	1	0	760	BF957	FUEL FILTER	17.48	8.01	8.01
64	1	1	0	760	8W5137	WATER FILTER - 4 UNI	31.25	12.57	12.57
65	1	1	0	760	BF7587	FUEL FILTER	39.03	15.70	15.70
66	18	18	0	415	24248	3" STRAIGHT RAD HOSE	5.18	3.44	61.92
67	1	1	0	760	B99	OIL FILTER	46.80	22.44	22.44
68	3	3	0	415	28444	1" GREEN STRIPE HEA	11.13	7.16	21.48
69	10	10	0	GRX	44-6SP-50/50	GREEN COOLANT	19.03	11.01	110.10
70	4	4	0	345	550G27653	ATF MERCON/DEX III-1	9.82	3.97	15.88

RECEIVED BY \_\_\_\_\_

SEE WARRANTIES  
ON REVERSE SIDE



# INLAND TRUCK PARTS & SERVICE

An Employee Owned Company

115 NORTH 16TH STREET  
PO BOX 1917  
Billings, MT 59103  
1-800-332-7077

Invoice

DATE	INVOICE NO.
11-26-13	1-87820
CUSTOMER P.O. NO.	CUSTOMER NO.
EVERETT	100333

REFERENCE	SHIP VIA	SHIP DATE	TERMS	BLM	CODES	B/O	PAGE
1-14265		11-26-13	NET 10TH	RWB		Y	3

**SOLD TO:** EVERETT GABLE  
2530 GOODMAN LN  
BILLINGS, MT 59101  
1-406-656-1570

 
Shipped To: EVERETT GABLE  
2530 GOODMAN LN  
BILLINGS, MT 59101  
1-406-656-1570

ITEM NO.	QUANTITY			PROD. LINE	PART NUMBER	DESCRIPTION	LIST PRICE	UNIT PRICE	EXTENSION
	ORDERED	SHIP	B/O						
71	1	1	0	416	G25170-1212	3/4HOSE X 3/4F JIC F	27.13	15.75	15.75
72	1	1	0	416	G25170-1216	3/4HOSE X 1"F JIC FL	32.40	18.82	18.82
73	2	2	0	210	24169	SS CLAMP HOSE/TUBING	35.71	14.50	29.00
74	52	52	0	345	500004741	15W40 ROTELLA T BULK	10.24	4.52	235.04
75	1	1	0	760	P528	PS STEERING FILTER	40.25	16.17	16.17
76	1	1	0	263	PART	MISC. PART		810.67	810.67
77						** REBUILD RAD			
78						REPAIR LABOR			5280.54
79						-----			
80						SHOP SUPPLIES			
81						R/O Phone#: 406-656-1570			194.71
82						-----			
<p>AS OF APRIL FIRST WE WILL NO LONGER BE MAILING A COPY OF THIS INVOICE PLEASE RETAIN THIS AS YOUR ONLY COPY OR FORWARD TO YOUR PAYABLE DEPARTMENT</p>									

Total Merchandise 13,997.62  
Total Labor 5,280.54  
-----  
Invoice Total 19,278.16

RECEIVED BY \_\_\_\_\_

SEE WARRANTIES  
ON REVERSE SIDE



# INLAND TRUCK PARTS & SERVICE

An Employee Owned Company

1011 INTERMOUNTAIN STREET  
PO BOX 1917  
BILLINGS, MT 59103  
1-800-332-7077

Invoice

DATE	INVOICE NO.
09-18-15	1-28174
CUSTOMER P.O. NO.	CUSTOMER NO.
EVERETT	100333

1987 KW W900

REFERENCE	SHIP VIA	SHIP DATE	TERMS	BLSM	CODE3	B/O	PAGE
1-52875		09-18-15	NET 10TH	TWB		Y	1

**SOLD TO:** EVERETT GABLE  
2530 GOODMAN LN  
BILLINGS, MT 59101  
1-406-656-1570

Shipped To: EVERETT GABLE  
2530 GOODMAN LN  
BILLINGS, MT 59101  
1-406-656-1570

ITEM NO.	QUANTITY			PROD LINE	PART NUMBER	DESCRIPTION	LIST PRICE	UNIT PRICE	EXTENSION
	ORDERED	SHIP	B/O						
1					Make/Year/Model: 1987 KENWORTH W900				
2					Unit Serial # : 9148996				
3					Vehicle Mileage: 89088				
4					*****				
5					< *** Repair Order 1/11/07 *** >				
6					CONDITION - STEERING WOBLES AT 45MPH				
7					CORRECTION - LIFTED TRUCK UP IN AIR AND CHECKED THE TIGHTNESS OF THE				
8					FRONT END, THE SPRING SHACKLE PINS WERE WORN OUT AND THE				
9					KING PINS AS WELL.				
10					REPLACED SPRING SHACKLE PINS ON LEFT REAR SPRING, REPLACED				
11					RIGHT SPRING, SHACKLE PINS AND U-BOLTS, REPLACED KING-PINE				
12	1	1	0	203	59-408	KENWORTH FRONT	1,050.00	457.68	457.68
13	2	2	0	202	TB-3/4X22	THREADED ROD	24.50	49.00	49.00
14	4	4	0	202	DN4	3/4" 16 NUT	3.35	13.40	13.40
15	4	4	0	202	UBW75	U-BOLT WASHERS 3/4	1.78	7.12	7.12
16	2	2	0	026	380001A	OIL BATH SEAL	85.58	171.16	171.16
17	2	2	0	245	330-3009	6 HOLE GASKET	2.97	5.94	5.94
18	1	1	0	204	70-961-12	KAISER NO BEAM	321.73	321.73	321.73
19	4	4	0	200	B1372-59	SPRING PINS	46.00	184.00	184.00
20	2	2	0	200	F65102	MONROE GAS MAGNUM 65	177.00	354.00	354.00
21	1	1	0	200	B1221-55	SPRING PIN	96.88	96.88	96.88
22	1	1	0	114	A2-3102F3464	TIE ROD ASSEMBLY	566.69	566.69	566.69
23	2	2	0	GRX	4007590EWS	75/90 SYN PT	10.09	20.18	20.18
24	2	2	0	245	359-5999	WINDOW KIT	13.03	26.06	26.06
25	2	2	0	290	452120	AIR BRAKE HOSE 1/2X2	24.40	48.80	48.80
26					FREIGHT IN				
27					REPAIR LABOR				
28					-----				
29					WARNING: Please see important wheel removal information below.				
30					CONDITION - INSTALL TURN SWITCH, FIX JAKE SWITCH @ CLUTCH PEDAL				
31					CORRECTION - INSTALLED THE TURN SIGNAL SWITCH THAT WAS SUPPLIED BY THE				
32					CUSTOMER.				
33					FIXED THE WIRING ON THE SWITCH AT THE CLUTCH PEDAL FOR THE				

RECEIVED BY \_\_\_\_\_

SEE WARRANTIES  
ON REVERSE SIDE



# INLAND TRUCK PARTS & SERVICE

An Employee Owned Company

1011 INTERMOUNTAIN STREET  
PO BOX 1917  
Billings, MT 59103  
1-800-332-7077

Invoice

DATE	INVOICE NO.
09-18-15	1-28174
CUSTOMER P.O. NO.	CUSTOMER NO.
EVERETT	100333

REFERENCE	SHIP VIA	SHIP DATE	TERMS	BLM	CODES	B/O	INSTR
1-62875		09-18-15	NET 10TH	TWB		Y	2


**SOLD TO:** EVERETT GABLE  
2530 GOODMAN LN  
BILLINGS, MT 59103  
1-406-656-1570

Shipped To: EVERETT GABLE  
2530 GOODMAN LN  
BILLINGS, MT 59103  
1-406-656-1570

ITEM NO.	QUANTITY			PROD LINE	PART NUMBER	DESCRIPTION	LIST PRICE	UNIT PRICE	EXTENSION
	ORDERED	SHIP	B/O						
34					ENGINE BRAKE. REPLACED THE ON/OFF SWITCH FOR THE ENGINE				
35					BRAKE.				
36	1	1	0	455	K301-201	SWITCH	120.00	80.04	80.04
37					REPAIR LABOR				110.00
38					.....				
39					CONDITION - REPLACE BRAKES ON THE REAR AXLE				
40					CORRECTION- REMOVED WHEELS AND HUBS. REPLACED BRAKE SHOES, BRAKE DRUMS				
41					AND WHEEL SEALS. REPLACED S-CAM BUSHINGS.				
42					REPLACED WHEEL STUDS ON RIGHT SIDE BECAUSE THE THREADS				
43					WHERE STRETCHED AND COULD HAVE COME OFF. THE STUDS WERE				
44					SEIZED INTO THE HUB SO THEY WERE EXTREMELY DIFFICULT TO				
45					REMOVE.				
46									
47					THE PRICE IS HIGHER ON THIS BRAKE JOB FROM THE VOLVO DUE TO				
48					THE BRAKE DRUMS BEING A 9" PILOT AND LESS COMMON.				
49					ALSO THE S-CAM BUSHINGS REQUIRED ATTENTION AS WELL.				
50	2	2	0	026	380003A	OIL BATH SEAL	111.41	55.74	111.48
51	2	2	0	GRX	4007590EWLS	75/90 SYN PT	10.09	6.45	12.90
52	2	2	0	235	13-7116	FLANGE GSKT, 8-HOLE	2.95	1.84	1.88
53	2	2	0	241	AX4515QK	STOP BOX KIT	116.92	77.36	133.75
54	1	1	0	235	08-131750	CAMSHAFT KIT (WHEEL)	12.70	8.00	8.00
55	2	2	0	242	66895B	BRAKE DRUM 10.50 X 7	45.00	22.50	45.00
56	10	10	0	235	13-1232R	STUD	9.69	5.95	59.50
57					REPAIR LABOR				489.50
58					.....				
59					WARNING: Please see important wheel removal information below.				
60					CONDITION - REPLACE WHEEL SEALS AND BRAKES ON FRONT TAG AXLE				
61					CORRECTION- REPLACED WHEEL SEALS AND BRAKE SHOES ON AXLE. REPLACED				
62					RIGHT HUB CAP.				
63					ADJUSTED BRAKES.				
64	1	1	0	245	359-5915	VENT PLUG	6.45	5.16	5.16
65	2	2	0	245	330-3009	6 HOLE GASKET	2.97	2.35	4.70
66	2	2	0	026	370131A	OIL BATH SEAL	105.01	59.82	119.64
67	2	2	0	241	EX130BTK	15X4 "T" SHOE KIT	149.10	88.93	177.86
68	1	1	0	026	343-249	HUB CAP	97.35	62.12	62.12
69	2	2	0	GRX	4007590EWLS	75/90 SYN PT	10.09	6.45	12.90

RECEIVED BY \_\_\_\_\_

SEE WARRANTIES  
ON REVERSE SIDE

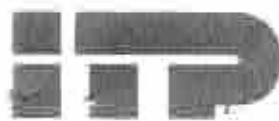

# INLAND TRUCK PARTS & SERVICE

An Employee Owned Company

1011 INTERMOUNTAIN STREET  
PO BOX 1917  
Billings, MT 59103  
1-800-332-7077

Invoice

DATE	INVOICE NO
09-18-15	1-28174
CUSTOMER P.O. NO	CUSTOMER NO
EVERETT	100333

REFERENCE	SHIP VIA	SHIP DATE	TERMS	PLSM	CODES	BID	PAGE
1-62875		09-18-15	NET 10TH	TWB		Y	3

**SOLD TO:** EVERETT GABLE  
2530 GOODMAN LN  
BILLINGS, MT 59101  
1-406-656-1570

Shipped To: EVERETT GABLE  
2530 GOODMAN LN  
BILLINGS, MT 59101  
1-406-656-1570

ITEM NO.	QUANTITY			PROD. LINE	PART NUMBER	DESCRIPTION	LIST PRICE	UNIT PRICE	EXTENSION
	ORGANIZED	SHIP	B/O						
70						REPAIR LABOR			250.80
71						.....			
72						CONDITION - REPLACE THE WRONG CROSSMEMBER BOLTS			
73						CORRECTION - REPLACED MISSING AND LOOSE BOLTS FOR CENTER CROSSMEMBER			
74						BETWEEN THE QUELS ON THE REAR END AFTER HAVING TO REDRILL			
75						THE WOBBLED OUT HOLES THAT RAN LOOSE.			
76						REPAIR LABOR			315.70
77						.....			
78						SHOP SUPPLIES			243.54
79						R/O Phone#: 406-656-1570			
80						*****			
<p>*****WE HAVE MOVED*****            COME SEE US AT OUR NEW LOCATION            1011 INTERMOUNTAIN STREET            *****NOW OPEN FOR BUSINESS*****</p> <p>WARNING - IMPORTANT INFORMATION</p> <p>.....</p> <p>The wheels of this vehicle have been removed and re-installed according to OEM specifications. Your vehicle will require the wheel nuts to be checked and re-torqued to the proper specifications after a specific number of miles of use. Check your owner's manual and follow the instructions. Failure to do so may result in the wheel coming loose causing damage to this vehicle and other property as well as serious bodily injury or death!</p> <p>.....</p>									

Total Merchandise	3,451.74
Total Labor	2,706.00
-----> Invoice Total	6,157.74

RECEIVED BY \_\_\_\_\_

SEE WARRANTIES  
ON REVERSE SIDE